

**Anchor Sheet or Base Ply, Field**

Mechanically attach or fully adhere (self-adhered, torch, cold process or hot asphalt). Proper attachment of the base layer is defined by specified system, product selection and deck type.

**Cap Sheet, Field**

Fully adhere (self-adhered, torch, cold process or hot asphalt). Proper attachment is defined by product selection. Extend base ply and cap sheet 2" above cant strip; adhere to cant strip only.

**Base Flashing**

WALL ATTACHMENT: Mechanically attach Anchor 12" o.c. or self-adhere Base Ply; Fully adhere Cap (self-adhered, torch-weld, cold process or hot asphalt; Gang fasten Base and Cap at top edge 9" o.c. with tin discs; Ensure 1.4"


bleed out on top edge or apply FlintBond® Caulk.

FIELD ATTACHMENT: Treat the granulated surface of Cap Sheet, Field, where the Base Flashing overlaps occurs:

**If self-adhered or using cold process** apply FlintBond Trowel to entire lapped surface with 1/4" bleed out or (in cold weather<sup>1</sup>) hot air weld<sup>2</sup> with bead of FlintBond Caulk at edge; **If torch-welded (cap only<sup>3</sup>)** heat sink/scrape the granules with heated trowel or granular embedment tool and ensure 1/4" bleed out; **if using hot asphalt** apply to entire lapped surface with 1/4" bleed out.

**Metal Counterflashing**

Mechanically attached with appropriate fastener approximately 24" o.c., apply bead of FlintBond Caulk along top edge.

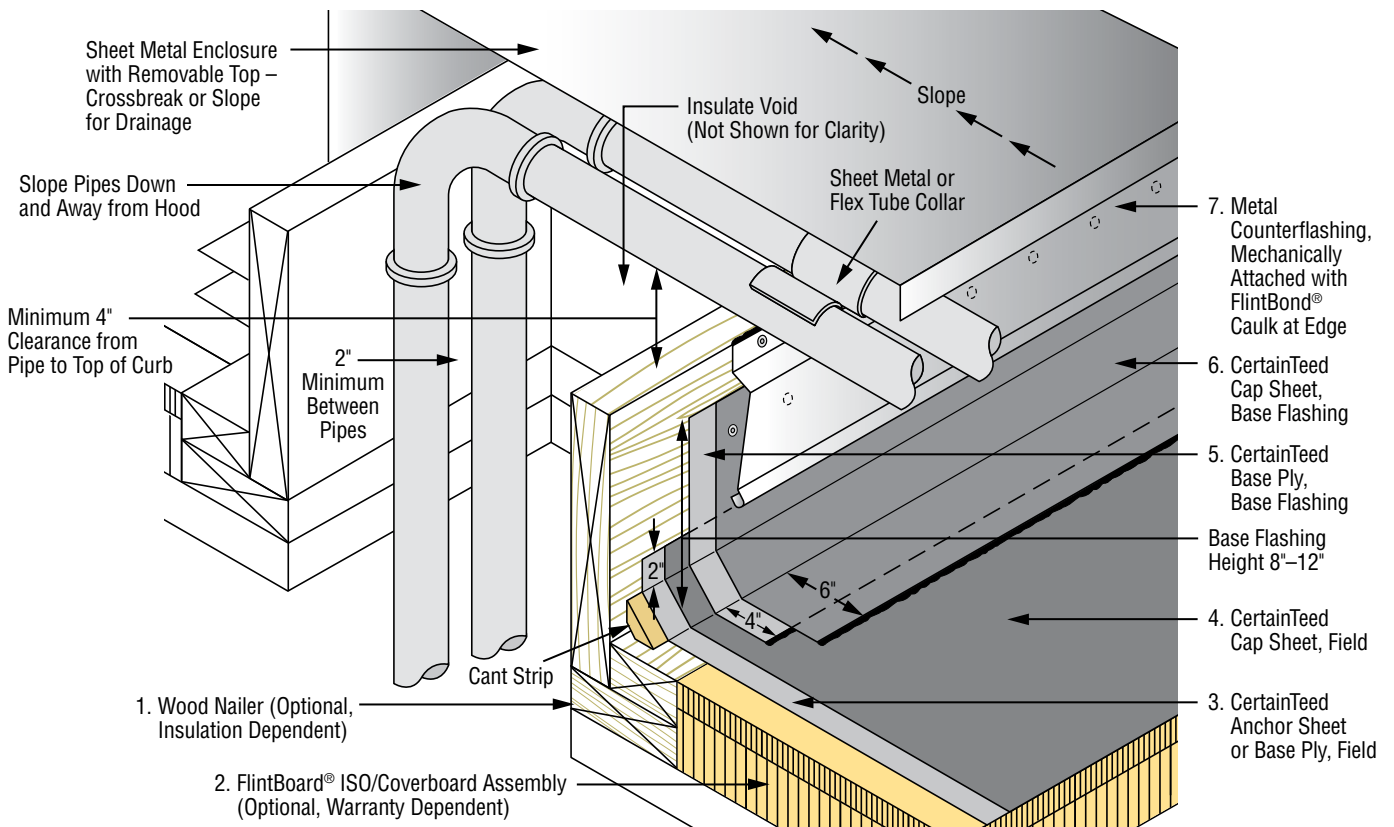

NOT DRAWN TO SCALE

<sup>1</sup>20°F-49°F (-6.6°C-4.4°C)

<sup>2</sup>Apply heat from a hot-air welder with a 2" tip to the overlapped granular surface while applying rolling pressure from a silicone roller to the overlapping Cap. With the hot air welder set between 900°F-1,100°F (setting 8-10), apply heat to the overlap interface while bonding Cap with rolling pressure on the granulated surface. Roll the overlapping Cap in place, moving the hot air welder to allow for forward progress. Avoid applying so much heat or moving at a pace that results in smoke. Apply a bead of FlintBond Caulk along the edge. Continue overlap application, 2" per pass.

<sup>3</sup>When potential fire hazards can be mitigated, CertainTeed considers it acceptable to install torch-applied CertainTeed Counterflashing using the direct torching method provided low output (50,000 BTU output or less) torching equipment is used. When potential fire hazards cannot be mitigated, torch-applied Counterflashing must be installed using the indirect methods such as torch and flop.